PLEASE READ THROUGH INSTRUCTIONS BEFORE STARTING ASSEMBLY.

1. PREPARATION

First select a suitable workspace which should be clean, dry, with adequate lighting and preferably free from distractions. You will need the following tools:

- 1. A light electric soldering iron, say 15 25 watts, with a fine bit.
- 2. Fine solder with a resin flux core: NOT acid type flux.
- 3. A sharp pair of sidecutters.
- 4. A magnifying glass optional, but very useful for inspecting solder joints and looking for shorts etc. on the printed circuit board.
- 5. Either a reel of desoldering braid or a "solder sucker" type tool it is almost impossible to remove a component with more than two leads from a board with plated through holes.
- 6. A piece of foam of at least the same area as the circuit board is useful for holding components in place whilst they are being soldered. The alternative is to bend the component leads flat against the back of the board, being careful not to short to adjacent tracks, but again, this can make it difficult to correct any mistakes once soldered.

2. PRECAUTIONS

Four of the integrated circuits (IC's) in the kit are of M.O.S. construction and are therefore susceptible to damage from static.

These IC's are the C.P.U. (IC1) and the memories (IC2, 3 and 4). Modern M.O.S. devices are not as fragile as they once were, but since these four are the most expensive IC's in the machine, a few handling precautions are worthwhile:-

- 1. Keep all the IC's in their protective packing until you actually want to install them in their sockets.
- 2. Never plug in or unplug the IC's with power applied to the board.
- 3. Use a soldering iron with a properly earthed bit if you need to solder to the board once the IC's are fitted.
- 4. Earth yourself, e.g. by touching an earthed piece of metal, prior to handling the IC's. If you get a shock doing this, a change of clothing may be advisable cotton and wool are less static prone than man-made fibres.
- 5. The white graphical component location markings on the PCB for the following capacitors C3, C9, C11, C14, C15 differ slightly to the location markings for other capacitors.

To ensure the correct locations of these capacitors during assembly <u>extra</u> care should be taken. Study diagrams A and B on the reverse side of this sheet.

Finally, if there is still no cursor, remove all I.C.'s from their sockets and with an Ohm meter check for a "short" due to a solder bridge between all the I.C. socket pins and the tracks running between them.

Once everything checks out, the case may be assembled (fig. 6). Fix the rivets in their holes by pushing the rod down until it is flush with the head.

8. OPTIONS


As constructed, the computer will display black symbols on a white background on your TV screen: this has been found to give the best readability. However, you may wish to use the more common white letters on black if your TV set can give a good enough picture, and a simple modification can accomplish this. First, cut the track between points "A" and "C" on the underside of the board with a sharp knife — be careful not to slip! — and solder in a short wire link (e.g. a resistor lead off-cut) between points "A" and "B".

Remember that the graphics symbols will also be reversed, and that reverse letting will now give black letters in a white box.

9. COMPONENT LIST

Resistors (All resistors will have a fourth band, which may be either gold or silver)

(A)			
Component No.	Value	Markings	Comments
R1 R2 R3 R4 R5 R6 R7 R8 R9 R10 R11 R12 R13 R14 R15 R16 R17 R18 R19 R20 R21 R22 R23 R24 R25 R26	1K 470 Ohms 1K 1K 1K 1K 1K 1K 1K 1K 1K 47K 47K 47K 47K 47K 47K 47K 47K 1K 2K2 330 Ohms 220K 1K 1K 1K	Brown Black Red Yellow Purple Brown Brown Black Red Yellow Purple Orange Red Red Red Red Red Brown Black Red Brown Black Red Brown Black Red Brown Black Red Yellow Purple Brown	

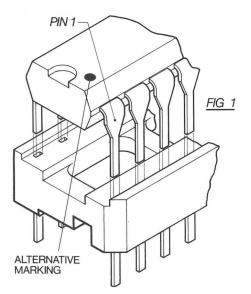

3. ASSEMBLY


First identify and check all the components. Note that some components need to be mounted one particular way round, as marked on the board — all the IC's, all the diodes (prefix D) and the two electrolytic capacitors (C8 and C10). All the resistors, the rest of the capacitors and the ceramic filter may be put either way round.

The IC's are identified by a notch at one end (fig. 1) and it is worth noting that the IC sockets also have identification of pin 1 position (fig. 1) — they can be put in either way round, but it will avoid possible confusion later on if they are mounted the same way round as the IC's they will carry. Note that all the IC's face the same way on the board, i.e. notch facing away from the keyboard.

N.B. SOME IC's MAY ONLY HAVE A MARK ABOVE PIN 1.

The diodes have their + end identified by a band painted on the body — or in the case of components with multiple bands, the widest band (fig. 2).

The electrolytic capacitors (C8, 10) will have either their + or - wires marked on the can (fig. 3). In addition, the + lead will usually be longer than the -.

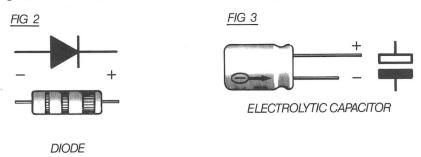

The power and tape sockets, the modulator and the regulator (IC22) also need to be mounted the right way round, but provided the drawings are followed (figs 4 & 5) this will happen automatically.

The board will be supplied with the keyboard fitted. All components go on this side, which has the component numbers printed on it as a guide to assembly — the component list tells you which component goes where.

All soldering should be done on the opposite side of the board (the side with a green coating — this stops solder going where it's not needed). Note that not all the holes have components in them — only the component holes need soldering, and only on the "green" side. Top soldering isn't necessary since the board has plated through holes. Do solder all component leads, though, even if they don't seem to go anywhere — they will be connected on the other side. Be careful no to put solder on the edge connector, and keep the iron away from the keyboard — it is plastic, and easily melted.

Brown Black Red

Yellow Purple Orange

R27

R28

1K


47K


R29 R30	180 Ohms 1K	Brown Grey Brow Brown Black Red	n	
R31	000 01	O		Not used
R32 R33	330 Ohms	Orange Orange Br	own	Not used
R34	1K	Brown Black Red	_	
R35 R36	1M	Brown Black Gree	en	Not used
R37				Not used
(B) Capacitors				
Component No.	Value	Markings	Com	ments
C1	47n	473M, 473Z		
C2	47n	473M, 473Z	Noti	and
C3 C4	47n	473M, 473Z	Not u	usea
C5	47n	473M, 473Z		
C6	47n	473M, 473Z		
C7		,	Not	used
C8	22µ	22μ 16ν		
C9	47p	47, 47p, 470J		
C10	1μ	1μ 63ν		
C11 C12	47p 100n	47, 47p, 470J 104, 0.1		
C12	47n	473M		
C14	47p	47, 47p, 470J		
C15	220p	220,220p,221 n22	33p	for USA (60 Hz).
(C) Semiconduc	ctors			

(C) Semiconductors					
Component No.	No. of pins	Type No.	Comments		
IC1 IC2 IC3 IC4 IC5 IC6 IC7 IC8 IC9 IC10 IC11	40 24 18 18 20 16 16 16 16 16 14	D780C-1 8332 µPD2114LC* µPD2114LC - 1 74LS373 74LS157 74LS157 74LS165 74LS367 74LS367 74LS00 74LS00	OR TMS 4732, may be alternatively labelled. May be prefixed SN, DM, etc. "" or 74LS365		


^{*}In case of supply difficulty may be same type as IC4.

COMPONENT LOCATION

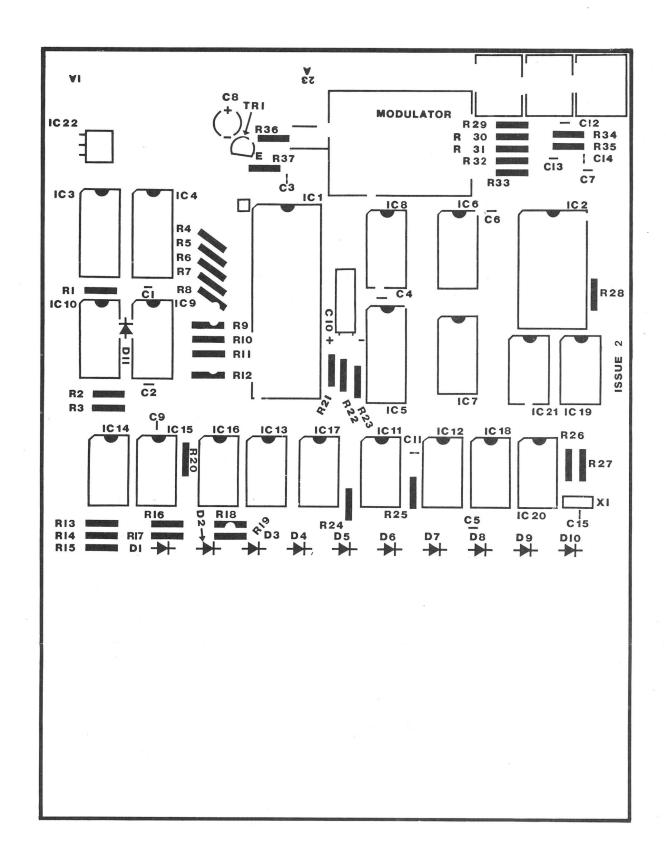

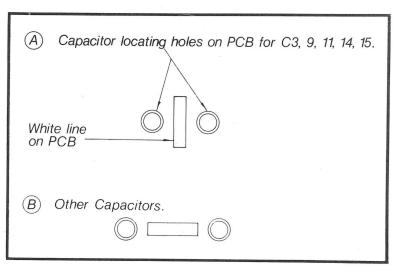


ZX80 CIRCUIT DIAGRAM

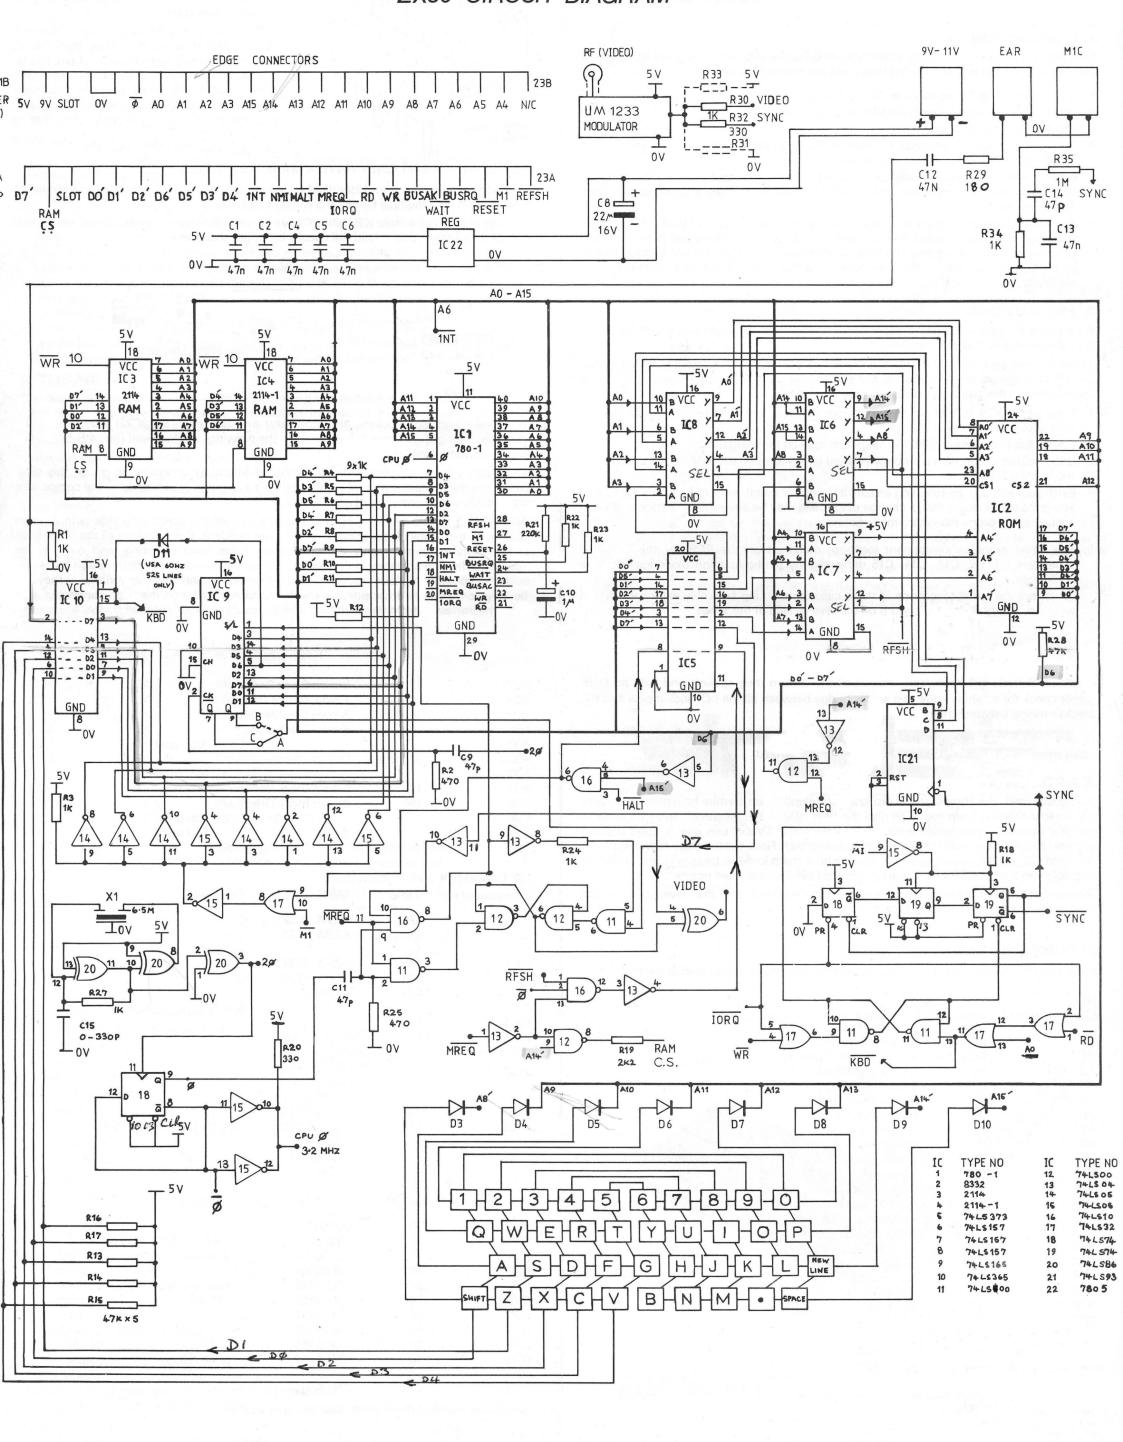

4. SUGGESTED CONSTRUCTION ORDER

- 1. The IC sockets but not the IC's yet. Make sure that each IC position has a socket with the appropriate number of pins — the component list says how many each IC has. IC22 doesn't have a socket — see step 5.
- 2. The resistors, diodes (D1 and D2 not used) and capacitors. Note that C8 mounts vertically on the board, while C10 lays down - make sure the leads are long enough to allow this. The top won't fit if C10 isn't flat enough.

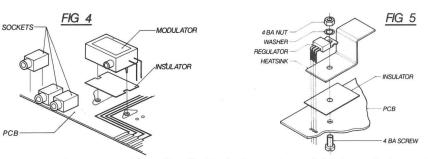

- 3. The tape and power sockets (fig. 4). Push the sockets right down before soldering, or again the top won't go on.
- 4. The ceramic filter X1.
- 5. The regulator IC22 (fig. 5). Bend the regulator's leads as in the diagram not too close to the plastic — and bolt it down firmly with the heatsink before soldering. Don't forget the insulator.
- 6. The modulator (fig. 4). Again, bend the modulator's leads to fit through the holes indicated on the board. A larger bit, or even a more powerful iron, may prove useful when soldering the modulator's pins. Don't try to bend these pins over - the board may get damaged. As before, make quite sure the insulator is in position before soldering.
- 7. Finally, insert all the IC's into their sockets, saving IC's 1 to 4 until last. The IC pins will be splayed out slightly and may need to be bent inwards before they will fit. This can be done by pushing each row of pins gently against a flat surface.

5. TESTING

The board is now assembled — but before trying the computer out, check it over very carefully for any stray solder blobs, and make sure that all the components are in the correct place: in particular, that the IC's and diodes are in the right way round. Any IC's which are inserted incorrectly may not only be destroyed themselves, but could also cause damage to others (see service).

Don't mount the board permanently in the case to begin with — simply rest it in the lower moulding whilst testing (see "Getting Started" - chapter 2 in "A Course in Basic Programming").

The regulator heatsink will get hot after the machine has been on for a time, and the large IC's will also get warm.

6. POWER SUPPLY

You may wish to use your own power supply to operate the ZX80. DC only should be used, with positive connected to the tip of a 3.5mm jack plug. Make absolutely certain that the supply is of correct polarity and voltage before switching on (see service). The

IC13	14	74LS04	"
IC14	14	74LS05	"
IC15	14	74LS05	
IC16	14	74LS10	"
IC17	14	74LS32	"
IC18	14	74LS74	"
IC19	14	74LS74	"
IC20	14	74LS86	"
IC21	14	74LS93	"
IC22	3	7805 or LM340T5	"
TRI			Not used
D3-D10		BA220 or BA221	D1 & D2 are not used.
		or IN4448	May be marked Red,
			Red, Black or Red, Red,
			Brown, Yellow, Yellow,
			Yellow, Grey.
D11		BA220 or IN4148	Only supplied for use
			on 525 line system to
			increase picture rate
			from 50 to 60 Hz.
X1 🗸		CDA6.5MC	3-lead ceramic filter

10. MISCELLANEOUS PARTS

3 off 3.5mm jack sockets

(NB — holes are provided for mounting 2 different styles of socket)

2 black plastic rivets (to hold keyboard/pcb to lower moulding)

5 white plastic rivets (to hold upper and lower moulding together)

2 self adhesive foam strips (for feet)

11. SERVICE

If, after having built your ZX80, it fails to work we will service it for a flat rate service fee of £10. In the exceptional case where several of the IC's have been damaged we may request an additional payment. The service fee should be enclosed together with the faulty ZX80, as service will not be undertaken until the fee is received.

© Sinclair Research Ltd. 1980.

IF THE FAULT WAS CAUSED BY FAULTY COMPONENTS SUPPLIED, WE WILL RETURN THE FULL SERVICE FEE.

Under no account will we reassemble or complete the assembly of a ZX80 kit.

The address of the Service Department is:-

ZX80 Service Department, Science of Cambridge Ltd.,


6 King's Parade, Cambridge CB2 1SN

voltage should be between 7 and 12 volts, and need not be regulated: if there is too much ripple, however, it will cause horizontal lines to pass through the picture. The computer will take a current of between 350 and 500 mA (typically 400mA) which remains essentially constant.

7. FAULTS

If the computer doesn't work properly, all that can be done without special equipment is to recheck the soldering and component locations (which you should have done before switching on!). Occasionally the likely area to look in can be narrowed down a little.

If the computer doesn't work at all, leave it on for a few minutes and feel the regulator (IC22). If it is not getting warm, check the mains supply, the fuse, and that the supply plug is in the right socket. If the regulator is getting warm, check the connection to the TV, and make sure the set is tuned in properly, (to UHF channel 36 - try between 33 and

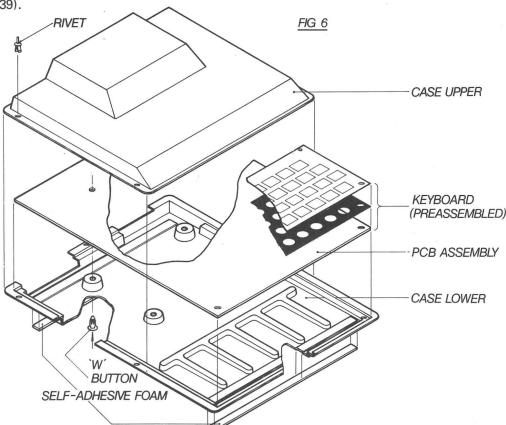

If the computer works for a while and then goes off, and the regulator gets very hot, make sure it is bolted firmly down on the heatsink. If the cursor appears on the screen (a black square with a white K in it) but the keyboard won't enter, first check that diodes D3 — D10 are the right way round, and that IC10 is properly in position.

If the screen goes clear but there isn't a cursor, first try switching off then on again after a few seconds. If that makes no difference, check that C10 and R21 are properly soldered





assembly instructions